

Part Number Update

Bulletin No: PNU-252

Effective Date: 01/24/2019

Cancels: N/A

Page: 1 of 1

subject: **Bendix® ACom® Diagnostic Software - Mandatory Update**


Bendix® ACom® diagnostic software v6.16.5.2 is now released and available for download on bendix.com. The earlier release, ACom software v6.16.5.0, has been removed from the Bendix website and should not be used as it may result in erroneous Diagnostic Trouble Codes (DTCs) on Bendix® ESP® Stability EC-80™ Electronic Control Unit (ECU). The new Bendix ACom software is available on bendix.com and must be used for troubleshooting.

If the DTCs shown in the table below were observed and continue to recur after connecting ACom diagnostic software v6.16.5.0 to a Bendix ESP Stability EC-80 ECU, then ACom diagnostic software v6.16.5.2 or greater must be used to clear the DTCs.

Diagnostic Trouble Codes (DTCs)		
SPN	FMI	Description
1067	11	PS1/PS2 Plausibility Error
1067	7	PS Not Calibrated
1045	2	Stop Light Switch Defective



The following confirmation dialog box will be displayed when the new version of ACom diagnostic software (v6.16.5.2 or greater) detects a controller with this condition and repairs it.

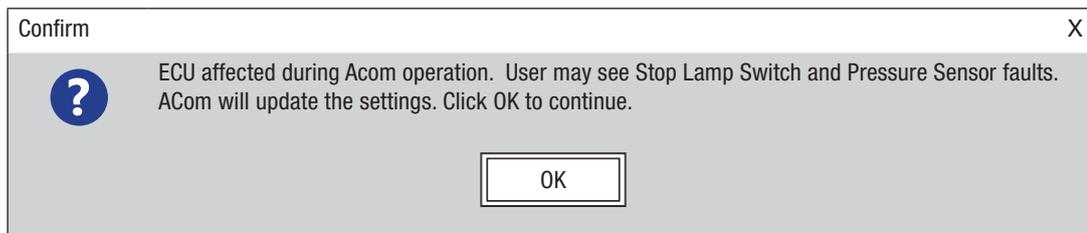

For additional information, contact the Bendix Tech Team at 1-800-AIR-BRAKE (1-800-247-2725) option 2, Monday through Friday, 8:00 a.m. to 6:00 p.m. ET.



Log-on and Learn from the Best
On-line training that's available when you are –24/7/365.
Visit brake-school.com.

